

Single Survey

survey report on:

| | |
|-------------------------|--|
| Property address | EWICH HOUSE, CRIANLARICH, FK20 8RU |
|-------------------------|--|

| | |
|-----------------|--------------------------------------|
| Customer | Mr Daniel Knecht & Mrs Silvia Knecht |
|-----------------|--------------------------------------|

| | |
|-------------------------|--|
| Customer address | Ewich House, Crianlarich, FK20 8RU |
|-------------------------|--|

| | |
|--------------------|-------------|
| Prepared by | DM Hall LLP |
|--------------------|-------------|

| | |
|---------------------------|---------------------|
| Date of inspection | 22nd September 2025 |
|---------------------------|---------------------|



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| | |
|--|--|
| Description | A detached house. |
| Accommodation | <p>ON GROUND FLOOR: Vestibule, hall, sitting room, dining room, open plan kitchen/living room and dining area, rear hallway, two bedrooms, side hallway, bathroom, laundry and toilet.</p> <p>ON UPPER FLOOR: Six bedrooms each with an en suite shower room with one separate bathroom.</p> |
| Gross internal floor area (m²) | Approximately 356 sq.m. |
| Neighbourhood and location | The property enjoys a rural position between the villages of Tyndrum and Crianlarich enjoying a degree of natural amenity whilst being relatively conveniently located for village facilities in each. The property is located approximately a hours travelling time from larger towns such as Oban, Paisley and more distant, Stirling, whilst the nearest main city of Glasgow is just in excess of one hour by road. There is a main line railway running from Crianlarich and Tyndrum to and from Glasgow and Oban and Fort William/Mallaig on the West Highland line. |
| Age | In excess of 200 years. |
| Weather | Dry following mixed weather conditions. |
| Chimney stacks | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>There are three partly rendered stone chimney heads with lead flashings.</p> |

| | |
|--|--|
| Roofing including roof space | <p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is pitched and clad with slates incorporating lead valleys and zinc ridging and hips.</p> <p>Access to the main roof spaces was through three hatches over the landing plus a hatch over the laundry at ground floor level.</p> <p>The main roof is formed with timber rafters and incorporates timber sarking. Partial under-slate felt was noted in places. The main roof space is insulated at the joists to various thickness whilst the roof space over the laundry was totally full of stored items and insulation was provided at the rafters, further restricting my inspection.</p> |
| Rainwater fittings | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater goods are cast iron and plastic with gutters of half round design.</p> |
| Main walls | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of solid stone construction whilst the extensions are of cavity block construction and timber framed construction with stone cladding externally.</p> |
| Windows, external doors and joinery | <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>WINDOWS: PVC sealed unit double glazed, timber framed sealed unit double glazed and one timber framed single glazed window provided.</p> <p>DOORS: The entrance door is timber. The rear door is timber single glazed. There are further timber sealed unit double glazed French doors to the rear and one PVC double glazed door to the side.</p> <p>JOINERY: There are timber roof line features.</p> |

Single Survey

| | |
|---|---|
| External decorations | Visually inspected. Paint or preservative stain finish. |
| Conservatories / porches | None. |
| Communal areas | None. |
| Garages and permanent outbuildings | Visually inspected. There are various outbuildings including a substantial stone garage and workshop with a pitched and slate clad roof. The garage has concrete flooring and timber doors. Electric light and power are provided and water is also supplied. PV panels are fitted on the east most roof pitch. There is a timber stable and a timber summer house utilised presently as an office. There is a further range of garden stores and an area of former outbuilding now providing a walled garden with timber log store. |
| Outside areas and boundaries | Visually inspected. There is garden ground to the front, sides and rear of the property stated to extend to 4.5 acres by Mr Knecht. At the time of inspection, the garden was mostly under snow, severely limiting my inspection. Areas of grass, stones, planting areas and timber decking were visible. Boundaries are formed by fencing and a burn. |
| Ceilings | Visually inspected from floor level. The internal finishes are of plasterboard. |
| Internal walls | Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plasterboard finish. |
| Floors including sub floors | Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Flooring is of solid and timber construction. I was unable to locate any hatch to the sub-floor area. |


| | |
|---|--|
| <p>Internal joinery and kitchen fittings</p> | <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal joinery timbers appear to have been renewed or date from the time of extension. The doors and some skirting and surrounds are formed in hardwood.</p> <p>The kitchen contains replacement units with an island breakfasting area. There is a china sink and a gas fired range style cooker with an extractor hood over.</p> |
| <p>Chimney breasts and fireplaces</p> | <p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There is a wood burning stove in the stone feature wall fireplace at the sitting room and there is a wood pellet burner on the stone slab floor in the living room area of the kitchen/dining area.</p> |
| <p>Internal decorations</p> | <p>Visually inspected.</p> <p>Paint, paper and tile finishes.</p> |
| <p>Cellars</p> | <p>None.</p> |
| <p>Electricity</p> | <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. 13 amp plug sockets and plastic coated cabling where visible. The electricity meters are located in external boxes at the rear whilst the switch gear is located in the rear hall cupboard.</p> |
| <p>Gas</p> | <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Bottled gas supply to the range style cooker provided.</p> |

Single Survey

| | |
|--|--|
| Water, plumbing, bathroom fittings | <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Private water supply. The visible installation is in copper and plastic materials.</p> <p>The en suite shower rooms contain white three piece suites with mixer showers, one of which has a two piece suite with the separate wash hand basin in the bedroom. The ground floor bathroom has a white four piece suite with a mixer shower in a separate cubicle and the first floor bathroom has a bath only.</p> |
| Heating and hot water | <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>An external Grant Vortex outdoor module oil fired boiler heats hot water and radiators throughout. Some areas have under-floor heating. The system is supplemented by the stoves. Hot water is also provided by electric immerser to a hot water cylinder located in the middle roof space.</p> |
| Drainage | <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is to septic tank.</p> |
| Fire, smoke and burglar alarms | <p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>A fire detection system and burglar alarm is provided.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance, if applicable.</p> |
| Any additional limits to inspection | <p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external</p> |

| | |
|---|---|
| <p>Any additional limits to inspection</p> | <p>communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>At the time of inspection, the property was occupied, furnished and floors were partly covered.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a licensed specialist.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.</p> <p>I was not able to inspect the sub floor area, due to lack of a known hatch.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p> |
|---|---|

Sectional Diagram showing elements of a typical house

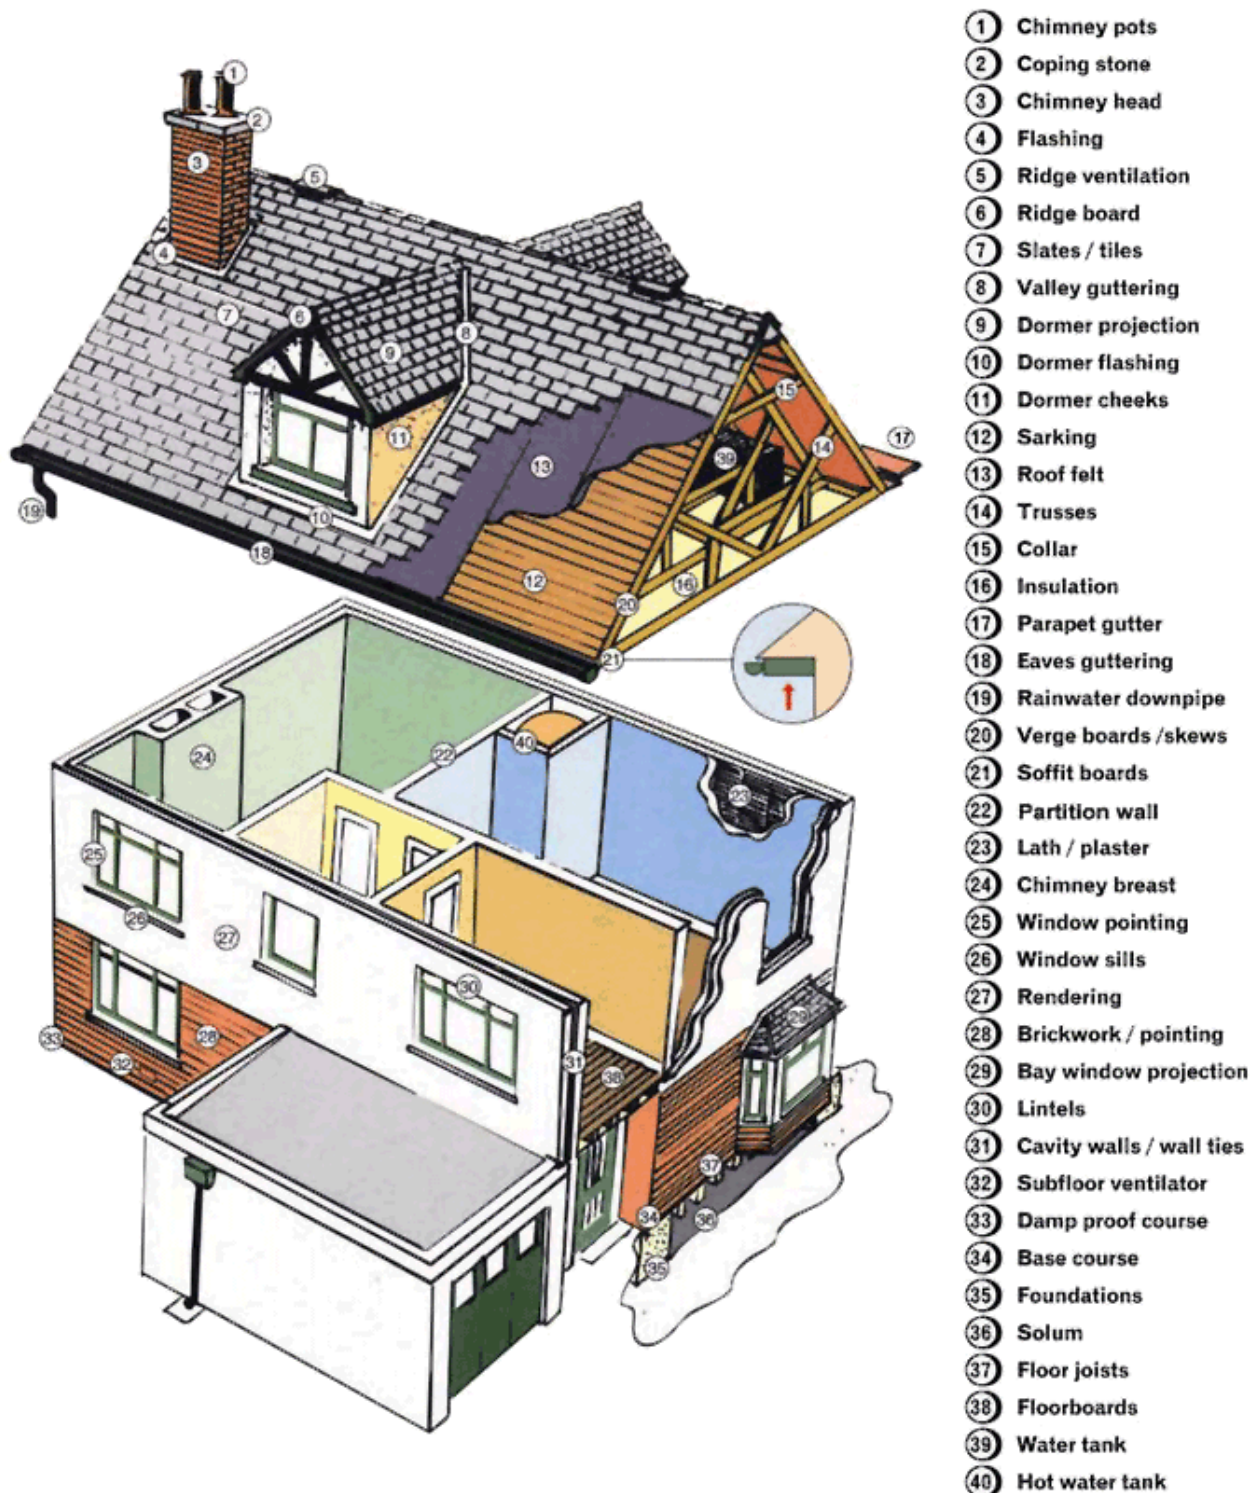

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partition wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

|  Structural movement | |
|---|---|
| Repair category | 1 |
| Notes | The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing. |

|  Dampness, rot and infestation | |
|--|---|
| Repair category | 2 |
| Notes | <p>Positive damp readings were detected to the lower walls pertaining to the exposed stone wall in the sitting room. In the original inspection in December 2022 it was noted that some of the floor timber has rot. The reinspection could not confirm this to be the case. Mr Knecht confirms that additional external drainage has been provided in this area and that timber preservation works have been carried out in the past. A timber & damp specialist can further advise to confirm if any concealed defects are present. Their recommendations, if any, should be implemented.</p> <p>There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation. This should be monitored. Further advice can be obtained from a specialist contractor.</p> <p>Woodworm was noted. This appears old and indeed Mr Knecht confirms that guarantees are available. This is not unusual in a property of this age, type and location.</p> |

|  Chimney stacks | |
|--|-----------------------------------|
| Repair category | 1 |
| Notes | Some moss accumulation was noted. |



Roofing including roof space

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | <p>Natural slates have an expected lifespan of up to 100 years or more depending on slate quality, source, thickness and cutting skill of the slate. Slates will deteriorate over time; nail fixings will corrode and loosen resulting in on-going maintenance requirements. Close quarter and disruptive inspections may reveal damage to roofing materials, especially where these are original. Regular maintenance should be anticipated particularly after adverse weather conditions.</p> <p>Missing, slipped, broken and chipped slates were noted. Corroded ridge fixings were apparent.</p> <p>Internally, insulation is not provided to current recommended thickness throughout. Insect nests were noted. Corroded slate nails were apparent. Dampness/condensation was recorded to timbers.</p> |



Rainwater fittings

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | <p>The original inspection confirmed a displaced downpipe at the front was noted to be leaking and that further leaking rainwater goods were noted. Some distorted guttering was apparent.</p> <p>It was dry during the reinspection, therefore we cannot fully comment on their adequacy.</p> <p>Cast iron rainwater fittings require periodic maintenance to prolong their lifespan.</p> |



Main walls

| | |
|------------------------|-------------------------------------|
| Repair category | 2 |
| Notes | Areas of loose pointing were noted. |



Windows, external doors and joinery

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | <p>Some window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>Handles and mechanisms to windows and doors would benefit from lubrication/maintenance in places.</p> |



External decorations

| | |
|------------------------|----------------------|
| Repair category | 2 |
| Notes | Weathered in places. |



Conservatories/porches

| | |
|------------------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |



Communal areas

| | |
|------------------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |



Garages and permanent outbuildings

| | |
|------------------------|--|
| Repair category | 2 |
| Notes | The outbuildings are generally adequate for purpose. The garage would benefit from some upgrading works in accordance with proposed usage. Rainwater goods, slates, external joinery, etc. would benefit from attention. |



Outside areas and boundaries

| | |
|------------------------|-----------------------------------|
| Repair category | 1 |
| Notes | Some damage was noted to fencing. |



Ceilings

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | Plaster cracking and visible plasterboard joints were noted. |



Internal walls

| | |
|------------------------|------------------------------------|
| Repair category | 1 |
| Notes | Some uneven areas of finish noted. |



Floors including sub-floors

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | <p>Some uneven and creaky flooring noted.</p> <p>Refer to subjection, 'Dampness, rot and infestation.'</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> |



Internal joinery and kitchen fittings

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | Some missing skirting boards were noted. |



Chimney breasts and fireplaces

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | Flues should ideally be swept and tested on an annual basis. |



Internal decorations

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | <p>Generally fresh although isolated staining was noted in places including where condensation or wind driven rain has run off velux windows.</p> <p>Peeling/scuffed/chipped paintwork was noted in places. Decoration is always a matter of personal taste.</p> |



Cellars

| | |
|------------------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |



Electricity

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations. |



Gas

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations. |



Water, plumbing and bathroom fittings

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | <p>It is not possible to comment upon the quality or adequacy of the private water supply but it is assumed that it is wholesome and acceptable for normal consumption patterns. I am not aware of any supply issues but further information can be obtained from a suitably qualified specialist contractor.</p> <p>It should be ensured that the seals around the sanitary fittings are maintained in a water tight condition.</p> |



Heating and hot water

| | |
|------------------------|---|
| Repair category | 2 |
| Notes | <p>The central heating boiler is of an older design. Informed opinion suggests that boilers have a life expectancy between 10 and 20 years depending on the quality of the boiler and whether or not regular maintenance has been carried out. Future repair or replacement should be anticipated.</p> <p>It is assumed that the central heating system has been properly installed and maintained to meet with all relevant regulations, particularly in respect of flue and ventilation requirements.</p> <p>Boilers and central heating systems should be tested and serviced by an Oftec registered engineer on an annual basis to ensure their safe and efficient operation.</p> |

Single Survey



Drainage

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | <p>No surface evidence of blockage or leakage apparent.</p> <p>Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.</p> |

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| | |
|---------------------------------------|---|
| Structural movement | 1 |
| Dampness, rot and infestation | 2 |
| Chimney stacks | 1 |
| Roofing including roof space | 2 |
| Rainwater fittings | 2 |
| Main walls | 2 |
| Windows, external doors and joinery | 1 |
| External decorations | 2 |
| Conservatories/porches | - |
| Communal areas | - |
| Garages and permanent outbuildings | 2 |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 2 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | 1 |
| Cellars | - |
| Electricity | 1 |
| Gas | 1 |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 2 |
| Drainage | 1 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| | |
|---|---|
| 1. Which floor(s) is the living accommodation on? | Ground floor |
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> No <input type="checkbox"/> |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

Access to the property from the A82 is by way of a tarred shared driveway and it is assumed that appropriate rights of access exist. The share of repair liability should be confirmed.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

It is not possible to comment upon the quality or adequacy of the private water supply but it is assumed that it is wholesome and acceptable for normal consumption patterns. I am not aware of any supply issues but further information can be obtained from a suitably qualified specialist contractor.

The property is trading as a guest house, however, the under noted valuation is based on the residential element of the property only and excludes any element of goodwill pertaining to the building.

Estimated reinstatement cost for insurance purposes

£1,750,000 (One Million Seven Hundred and Fifty Thousand Pounds).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£725,000 (Seven Hundred and Twenty Five Thousand Pounds).

Our valuation reflects current market conditions since the recent downturn from the post covid peak and higher interest rates.

| | |
|----------------------|---|
| Signed | Security Print Code [369030 = 7021] Electronically signed |
| Report author | Wesley Weld-Moore |
| Company name | DM Hall LLP |

Single Survey

| | |
|----------------|---|
| Address | The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX |
|----------------|---|

| | |
|-----------------------|---------------------|
| Date of report | 23rd September 2025 |
|-----------------------|---------------------|

Mortgage Valuation Report



Property Address

Address EWICH HOUSE, CRIANLARICH, FK20 8RU
Seller's Name Mr Daniel Knecht & Mrs Silvia Knecht
Date of Inspection 22nd September 2025

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Further timber summer house/office, stables, greenhouse and stores.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No
If Yes, is this recent or progressive? Yes No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Oil fired central heating predominantly to radiators, supplemented by wood burning stoves.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No
If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

At the time of the inspection, the property was occupied, furnished and floors were partly covered. The condition of the property is generally satisfactorily commensurate with age and type. Some repairs and maintenance works are required and ongoing works should be anticipated.

It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Drainage is to a septic tank. It is assumed that the tank is registered with SEPA. The position regarding age, location, condition and maintenance history should be clarified.

It is not possible to comment upon the quality or adequacy of the private water supply but it is assumed that it is wholesome and acceptable for normal consumption patterns. I am not aware of any supply issues but further information can be obtained from a suitably qualified specialist contractor.

Access from the main A82 by a made up track and it is assumed that appropriate rights of access exist. Share of repair liabilities should be ascertained.

The other accommodation noted above is a laundry.

Essential Repairs

None.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for most lenders, depending on their individual criteria.

Valuations

| | | |
|---|------------------------------|--|
| Market value in present condition | £ | <input type="text" value="725,000"/> |
| Market value on completion of essential repairs | £ | <input type="text" value="-"/> |
| Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) | £ | <input type="text" value="1.75m"/> |
| Is a reinspection necessary? | <input type="checkbox"/> Yes | <input checked="" type="checkbox"/> No |

Buy To Let Cases

| | | |
|---|------------------------------|--------------------------------|
| What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? | £ | <input type="text" value="-"/> |
| Is the property in an area where there is a steady demand for rented accommodation of this type? | <input type="checkbox"/> Yes | <input type="checkbox"/> No |

Declaration

| | |
|-----------------------------|--|
| Signed | Security Print Code [369030 = 7021] Electronically signed by:- |
| Surveyor's name | Wesley Weld-Moore |
| Professional qualifications | MRICS |
| Company name | DM Hall LLP |
| Address | The Oban Times Building, Corran Esplanade, Oban, Argyll, PA34 5PX |
| Telephone | 01631 564225 |
| Fax | |
| Report date | 23rd September 2025 |