

Single Survey

survey report on:

Property address	19 Nicol Street, Elgin, Morayshire, IV30 6BU
-------------------------	-------------------------------------------------------

Customer	
-----------------	--

Customer address	19 Nicol Street, Elgin, Morayshire, IV30 6BU
-------------------------	-------------------------------------------------------

Prepared by	Allied Surveyors Scotland Ltd
--------------------	-------------------------------

Date of inspection	22nd May 2026
---------------------------	---------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein*

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a detached one and a half storey detached house together with associated grounds and outbuildings.
Accommodation	The accommodation may be summarised as follows: Ground floor - Hall, kitchen, living room, sitting room, bedroom, rear vestibule and shower room. First floor - Landing and two bedrooms.
Gross internal floor area (m²)	Approximately 106 sq m
Neighbourhood and location	The subjects are located within the established area of New Elgin which lies to the south of the town of Elgin. Surrounding properties are of a similar age and type, generally residential in nature. Local amenities including shops, schools and transport facilities can be found nearby,
Age	Estimated to be in excess of 100 years old.
Weather	Weather conditions were dry at the time of inspection.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimney stacks are of a stone construction with metal or cement flashing detail.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as

<p>Roofing including roof space</p>	<p>being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof structures are of a pitched design, clad with slates over timber trusses. Valleys are consistent with being formed in lead and have had a bituminous coating or similar applied over some areas and slates.</p> <p>Internally the roof voids were inspected from hatches in the hall and rear vestibule on a restricted 'head and shoulders' basis. This found the area to be overlaid with insulation. No access was possible to the roof at first floor level.</p> <p>Our inspection was limited to from street view and via a 3m extendable ladder from the side elevation. As a result, some aspects of the roof including the middle slopes and valleys were not fully visible.</p>
<p>Rainwater fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The rainwater goods are formed in uPVC or cast iron.</p>
<p>Main walls</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The main outer walls are of a solid stone construction, pointed externally.</p>
<p>Windows, external doors and joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows are of a replacement uPVC type with double glazed units.</p> <p>The external doors are of a timber and glazed type.</p> <p>There are some timber fascia's.</p>
<p>External decorations</p>	<p>Visually inspected.</p> <p>External timbers, rainwater goods and some masonry areas have been painted.</p>

Single Survey

Conservatories / porches	Not applicable.
Communal areas	Not applicable.
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>There is an extended garage with lean to and stores to the side of the property which has been built to the side of the neighbouring property. The walls are constructed with numerous materials including block, stone, corrugated cement fibre sheeting and timber. The roof is clad with corrugated iron or profiled metal sheeting.</p> <p>There is also a lean to brick store.</p>
Outside areas and boundaries	<p>Visually inspected.</p> <p>There are grounds to the side and rear of the property which typically include a number of vegetable/flower patches, patio/paving and grass areas.</p> <p>Boundaries are generally formed in timber post and panel fencing with some areas of corrugated metal.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Ceilings are consistent with being plasterboard or lath and plaster lined.</p>
Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal walls are consistent with being plasterboard or lath and plaster lined, with some areas of timber linings and wet wall.</p>
Floors including sub floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Flooring is of a solid or suspended timber design.</p> <p>No access was possible to any sub floor areas as a result of fitted floor coverings.</p>


Single Survey

Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal joinery consists of timber doors, skirtings and facings as well as flush panel doors.</p> <p>Kitchen fittings comprise a base unit with stainless steel sink over, and wall units.</p>
Chimney breasts and fireplaces	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>There are a number of blocked fireplaces.</p> <p>There is an open fireplace in the sitting room. This has been blocked off with paper.</p>
Internal decorations	<p>Visually inspected.</p> <p>Internally, walls and ceilings are typically lined with paint, paper or tiling.</p>
Cellars	<p>Not applicable.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>The subjects are connected to the mains electricity supply. The distribution appears to be protected by a series of circuit breakers fitted in the under-stair cupboard.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>The subjects are understood to be connected to the mains gas supply. The meter box was stiff and not opened.</p>

Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>The subjects are understood to be connected to the mains water supply. Where visible pipework is formed in copper or uPVC.</p> <p>Shower room fittings comprise a WC, wash hand basin and shower cubicle with mixer fitting.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Heating is provided by a gas fired greenstar boiler fitted in the landing cupboard which supplies a series of radiators throughout the property. Hot water is provided via the aforementioned system.</p>
Drainage	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is understood to be to the main public sewer.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are some smoke detectors fitted in the property.</p> <p>The new Fire and Smoke Alarm Standard came in to force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor.</p> <p>A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. The purchaser should satisfy themselves in this regard.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and/or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>

<p>Any additional limits to inspection</p>	<p>For flats / maisonettes</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</p> <p>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</p> <p>The property had floor coverings in place.</p> <p>Parts of the property which are covered, unexposed or inaccessible cannot be guaranteed to be free from defect.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.</p> <p>Not all windows and doors were tested at the time of our inspection.</p> <p>Inspection of the roof space was restricted to areas visible from the hatch. Inspection was restricted by the presence of insulation material and the storage of personal effects. Insulation was not disturbed in accordance with Health & Safety guidelines and furniture, personal effects (particularly in cupboards) and floor coverings have not been moved.</p> <p>No access was possible to the sub floor areas.</p> <p>Areas under the shower tray were not visible at the time of inspection and therefore no comment can be made on the condition of these areas.</p> <p>No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns, then they should ask for a specialist to undertake appropriate tests. Asbestos is not harmful unless fibres are released into the air.</p> <p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>
---------------------------------------------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Sectional Diagram showing elements of a typical house

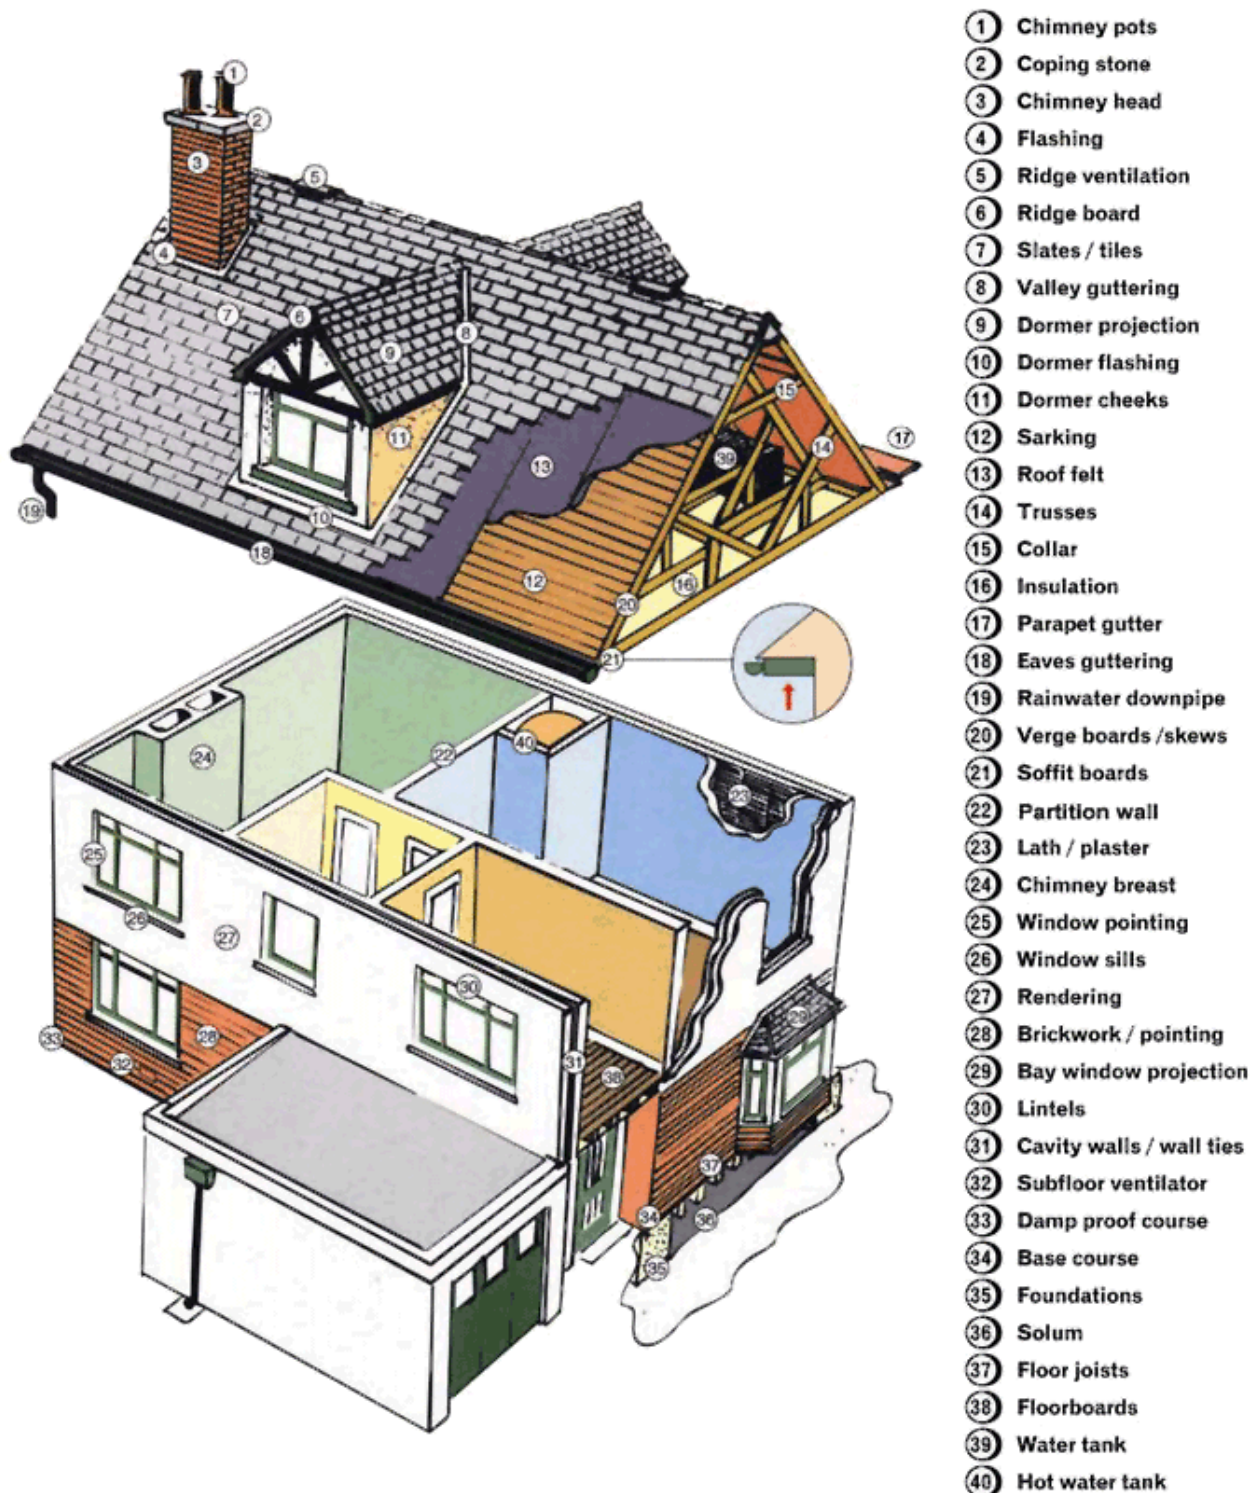


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.

 Dampness, rot and infestation	
Repair category	3
Notes	<p>Elevated moisture meter readings were noted in various locations throughout the property, most notably to walls at various levels, particularly in lower areas, walls and ceilings adjacent to the valley and sloping ceilings, and the kitchen fireplace, where some staining and softness to adjacent timbers were also observed. It is recommended that further investigations are carried out and all necessary remedial works undertaken.</p> <p>There is evidence of woodworm infestation notably affecting, but not limited to, timbers in the roof void, flooring, wall linings and door frames. The extent/status of activity is uncertain and further investigation is recommended to confirm the nature and extent of any necessary remedial work if required.</p>

 Chimney stacks	
Repair category	2
Notes	Cracking and weathering was noted to the stonework and pointing.

 Roofing including roof space	
Repair category	2
Notes	<p>There are cracked and slipped slates.</p> <p>Some areas of the valley and surrounding area have been finished with a bituminous or similar coating over.</p>



Roofing including roof space

Repair category	2
Notes	<p>Corrosion was noted to the skylight.</p> <p>There are areas of defective pointing.</p> <p>Some flashing details require overhaul/repair works with loose and corroded fittings and some holes noted.</p> <p>Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</p>



Rainwater fittings

Repair category	2
Notes	<p>There is evidence of corrosion which may result in leakage.</p>



Main walls

Repair category	2
Notes	<p>Cracking and weathering was noted to stonework and pointing.</p> <p>Staining was noted to stonework in some areas.</p>




Windows, external doors and joinery


Repair category	2
Notes	<p>Some weathering and decay was noted to external timbers.</p> <p>There is no latch on the side door, only the lock.</p> <p>Windows generally appeared in fair order, consistent with age and type.</p> <p>Windows can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance/repair will be required as part of an ongoing maintenance programme.</p>





External decorations


Repair category	2
Notes	<p>Overhaul/repair works are required to external decorative finishes including possible repairs to external joinerywork/ metalwork prior to redecoration.</p>

 Conservatories/porches	
Repair category	-
Notes	Not applicable.

 Communal areas	
Repair category	-
Notes	Not applicable.

 Garages and permanent outbuildings	
Repair category	3
Notes	<p>The garage/outbuildings are in poor condition and should be repaired to bring it to an acceptable standard for their purpose.</p> <p>The garage/outbuildings may contain asbestos material. The current informed view is that if left undisturbed this will present no significant hazard to health. However some potential purchasers may be deterred by its presence and in the event of damage or disturbance significant costs should be anticipated in respect of removal and handling.</p>

 Outside areas and boundaries	
Repair category	2
Notes	<p>Fence timbers are subject to weathering and decay, with some broken bits.</p> <p>Grounds are overgrown in some areas.</p> <p>There are trees in close proximity to the property. Whilst no associated damage was noted, trees can cause problems to the structures and services beneath the ground. (specialist advice may be prudent)</p>

 Ceilings	
Repair category	2
Notes	As previously mentioned, elevated moisture meter readings and woodworm flight holes were noted.



Internal walls

Repair category	2
Notes	As previously mentioned, elevated moisture meter readings were noted. Cracking and blemishes have occurred and some plaster repairs may be required (during redecoration).



Floors including sub-floors

Repair category	2
Notes	As previously mentioned, woodworm flight holes were noted. There are areas of uneven flooring.



Internal joinery and kitchen fittings

Repair category	2
Notes	Kitchen fittings are limited, although in fair order, subject to some wear and tear. Some wear and tear and cracks were noted to internal joinery. As previously mentioned, woodworm flight holes were noted.



Chimney breasts and fireplaces

Repair category	3
Notes	There are warning stickers indicating not to use the services. This should be tested prior to reuse. As previously mentioned, elevated moisture meter readings were noted adjacent with some staining and softness noted to timbers.



Internal decorations

Repair category	2
Notes	Some redecoration works will be required as part of remedial works to walls and ceilings etc.



Cellars

Repair category	-
Notes	Not applicable.

Single Survey



Electricity

Repair category	3
Notes	<p>There are warning stickers indicating not to use the services. This should be tested prior to reuse.</p> <p>There is exposed wiring in the attic. Although this may be an earth cable this was not confirmed and should be checked to ensure it is not live.</p>



Gas

Repair category	2
Notes	<p>There are warning stickers indicating not to use the services. This should be tested prior to reuse.</p>



Water, plumbing and bathroom fittings

Repair category	2
Notes	<p>There are warning stickers indicating not to use the services. This should be tested prior to reuse.</p> <p>The sanitary fittings appeared in fair order consistent with age.</p>



Heating and hot water

Repair category	2
Notes	<p>There are warning stickers indicating not to use the services. This should be tested prior to reuse.</p>



Drainage

Repair category	1
Notes	<p>The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.</p>

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	3
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	3
Internal decorations	2
Cellars	-
Electricity	3
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first floors	
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/>	No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.

Some outbuildings have been built onto the neighbouring property wall. We have assumed that suitable legal arrangements are in place for this. This should be confirmed.

Estimated reinstatement cost for insurance purposes

£810,000 (Eight Hundred and Ten Thousand Pounds).

We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than the above noted figure.

Valuation and market comments

The current Market Value of the heritable subjects, with the benefit of vacant possession would be fairly stated in a figure of £170,000 (One Hundred and Seventy Thousand Pounds).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Signed	Security Print Code [517466 = 5116] Electronically signed
Report author	A F Gunn
Company name	Allied Surveyors Scotland Ltd
Address	35 Moray Street, Elgin, IV30 1JH

Single Survey

Date of report	28th May 2026
-----------------------	---------------

Mortgage Valuation Report



Property Address

Address 19 Nicol Street, Elgin, Morayshire, IV30 6BU
Seller's Name
Date of Inspection 22nd May 2026

Property Details

Property Type House Bungalow Chalet Purpose built maisonette
 Coach Studio Converted maisonette Purpose built flat
 Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Brick store

Mortgage Valuation Report

Construction

- Walls Brick Stone Concrete Timber frame
 Solid Cavity Steel frame Concrete block Other (specify in General Remarks)
- Roof Tile Slate Asphalt Felt
 Lead Zinc Artificial slate Flat glass fibre Other (specify in General Remarks)

Special Risks

- Has the property suffered structural movement? Yes No
If Yes, is this recent or progressive? Yes No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

- Drainage Mains Private None
Electricity Mains Private None
Central Heating Yes Partial None
- Water Mains Private None
Gas Mains Private None

Brief description of Central Heating:

Gas fired wet central heating system.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

- Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Agricultural land included with property Ill-defined boundaries Other (specify in General Remarks)

Location

- Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

- Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Some outbuildings have been built onto the neighbouring property wall. We have assumed that suitable legal arrangements are in place for this. This should be confirmed.

There is evidence of settlement in the building noted both internally and externally but this is not inconsistent with a property of this age and type and on the basis of a single inspection appears to be longstanding.

Essential Repairs

The following are considered to be essential. For the avoidance of doubt this is a retention for mortgage purposes and not an estimate for any costs of repair.

Elevated moisture meter readings were noted in various locations throughout the property, most notably to walls at various levels, particularly in lower areas, walls and ceilings adjacent to the valley and sloping ceilings, and the kitchen fireplace, where some staining and softness to adjacent timbers were also observed. It is recommended that further investigations are carried out and all necessary remedial works undertaken.

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The subjects would provide adequate security for lending institutions loan purposes subject to the specific lending institutions criteria.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [517466 = 5116]
Electronically signed by:-

Surveyor's name A F Gunn

Professional qualifications MRICS

Company name Allied Surveyors Scotland Ltd

Address 35 Moray Street, Elgin, IV30 1JH

Telephone 01343 547481

Fax 01343 549774

Report date 28th May 2026